

TEST REPORT

APPLICANT : Biohouse (Shanghai) Co.,Ltd

ADDRESS : 16H, Building No.2, #515 Yishan Rd., Shanghai, 200235

SAMPLE DESCRIPTION : Solid oak floor coated with biohouse Natural Oil 9430

SAMPLE RECEIVED DATE : 10-Apr-2012

TURN AROUND TIME : 10-Apr-2012 To 09-May-2012

TEST RESULT : For further details, please refer to the following page(s)

Eurofins (Shanghai) contact information**Customer service:** AstridShen@eurofins.com / 021-61819170 / 13661725727**Sales specialist:** RoyFeng@eurofins.com / 021-61819107 / 13665199521


***** FOR FURTHER DETAILS, PLEASE REFER TO THE FOLLOWING PAGE(S) *****

Signed for and on behalf of
Eurofins Product Testing Service (Shanghai) Co., Ltd



Terric Ji
Lab Manager

SAMPLE PHOTO(S)

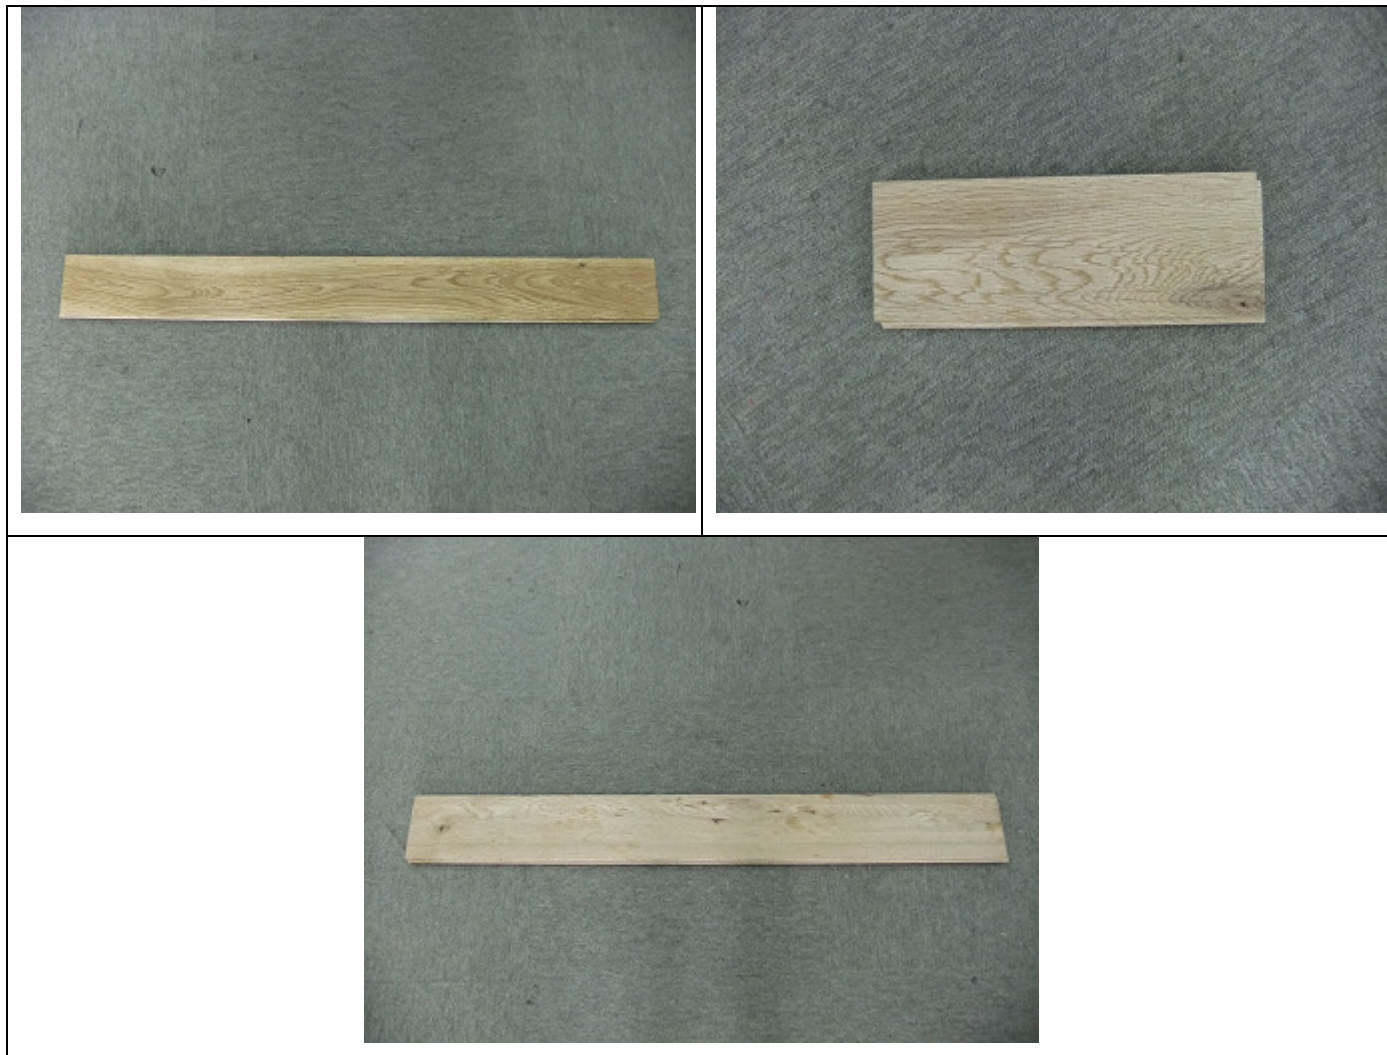

EFSH12040436-ST-01

TO BE CONTINUED

TEST RESULT

Test method:

Refer to DD CEN/TS 15676:2007 Wood flooring-Slip resistance-Pendulum test

Specimens: 285mm×90mm×20mm, 6pcs, see the photo

Test result:

Test direction: parallel to the stripe of surface

Specimens identification No.	1	2	3	4	5	6
Mean pendulum test value (Dry condition)	80	82	79	79	79	83
Slip resistance value (SRV "dry")	80					
Mean pendulum test value (Wet condition)	52	48	46	41	49	46
Slip resistance value (SRV "wet")	47					

Note: 1. The samples were cut from the product with the size 900mm×90mm×20mm by Eurofins engineer.

2. The test was performed by Eurofins internal laboratory.

*** END OF THE REPORT ***